



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

5012566

D119-796-141
Job Sheet 165701



Part No: D119-796-141

Job Qty: 1 ea

Part Name: Fwd Crosstube Installation Without Step (No Hardware)



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 9/30/17

Job Tracking No:

Due Date: 10/31/17

Created By: Mario Poulin

Type: Stock

Description:

Note: DWG IIN-D119-796 REV F, D119-796-141 REV H IPP REV:A 14.09.03 NEW ISSUE DD VERF:JLM IPP REV:B 14.10.15 AS PER REV.B DD VERF:JLM IPP REV:C 14.11.19 AS PER REV.C DD VERF:JLM IPP REV:D 14.12.12 AS PER REV.pd1 DD VERF:JLM IPP REV:E 15.02.11 AS PER REV F JLM VERIFIED BY:DD

Ship Via:

Bill of Materials

Part/Part Name	Part Note	Serial No	Quantity	Location
D119-796-141 Fwd Crosstube Installation Without Step (No Hardware)	DWG IIN-D119-796 REV F, D119-796-141 REV H IPP REV:A 14.09.03 NEW ISSUE DD VERF:JLM IPP REV:B 14.10.15 AS PER REV.B DD VERF:JLM IPP REV:C 14.11.19 AS PER REV.C DD VERF:JLM IPP REV:D 14.12.12 AS PER REV.pd1 DD VERF:JLM IPP REV:E 15.02.11 AS PER REV F JLM VERIFIED BY:DD		0.000	
CR3212-4-08 Rivet			0.000	
D119-796-141TRN Crosstube Turning Detail	DWG REV H IPP REV A RQ 14/06/06 VERIFIED BY DD IPP REV:B 16.05.04 AS PER DWG REV.H DD VERF:JLM		0.000	
D2873-043 Nut Plate Assembly	DWG REV A IPP A 05.09.13 New issue KJ/JLM		0.000	
D5123-3 Clamp Cushion	DWG REV D IPP REV:A NEW ISSUE 14-08-28 JLM VERIFIED BY:DD IPP REV:B 16-11-11 AS PER DWG REV.D DD VERF:JLM		0.000	
D5124-1 Fwd Support	DWG REV B IPP rev A RQ verified by JLM 14/08/08		0.000	
D5152-041 Fwd Post Mount Assembly	DWG REV B SHEET 1 IPP REV:A 15.01.09 NEW ISSUE DD VERF:JLM		0.000	
D5305-1 Shim	DWG REV A IPP REV:A 15.09.04 NEW ISSUE DD VERF:JLM		0.000	
MS21920-24 Clamp			0.000	

Job Routing

Op No	Operation	Qty	Due Date	Standard		Workcenter/Supplier	
				Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time
90	Start up Operation	1 Ea	10/30/17	0.00	0.00	Start up container	
110	DC	1 pcs	10/30/17	0.00	0.00	DC	
120	Packaging	1 pcs	10/30/17	0.00	0.00	Packaging1	
130	CNC Bend Crosstubes	1 pcs	10/30/17	0.00	3.85	CNC Bend Crosstube	DAS
140	QC	1 pcs	10/30/17	0.00	0.00	QC15	47
145	Crosstubes	1 pcs	10/30/17	0.00	2.50	Crosstube	9.39
150	Crosstubes	1 pcs	10/30/17	0.00	2.50	Crosstube	
160	HandFXtube	1 pcs	10/30/17	0.00	1.49	HandFinish5	
170	QC	1 pcs	10/30/17	0.00	0.00		
175	QC	1 pcs	10/30/17	0.00	0.00	QC7	

DART
AEROSPACE

S010827

DART
AEROSPACE

S012566



Fwd Crosstube Installation Without Step (No Hardware)

PART NO:

D119-796-141

Revision:

Operation:

Change No:

SprayPaint

Mfg Date: 11/22/17
Job No: 165701

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

180	Outsource	1 pcs	10/30/17	0.00	0.00	✓	Outsource2
190	Packaging	1 pcs	10/30/17	0.00	0.00	✓	Packaging1 DAS
200	QC	1 pcs	10/30/17	0.00	0.00	✓	QC5 38
230	SprayPaint	1 pcs	10/30/17	0.00	0.93	✓	Spray Paint AB DEC 03 2017
240	QC	1 pcs	10/30/17	0.00	0.00	✓	QC14 38
242	Crosstubes	1 pcs	10/30/17	0.00	2.50	✓	Crosstube DAS
244	QC	1 pcs	10/30/17	0.00	0.00	✓	QC5 38
246	SprayPaint	1 pcs	10/30/17	0.00	0.93	✓	Spray Paint AB DEC 17-12-19
248	SprayPaint	1 pcs	10/30/17	0.00	0.93	✓	Spray Paint AB DEC 17-12-19
250	QC	1 pcs	10/30/17	0.00	0.00	✓	QC14
252	Crosstubes	1 pcs	10/31/17	0.00	2.50	✓	Crosstube AB DEC 21 2017
260	QC	1 pcs	10/31/17	0.00	0.00	✓	QC5
290	Packaging	1 pcs	10/31/17	0.00	0.00	✓	Packaging3 AB DEC 21 2017
300	QC21-FG	1 Ea	10/31/17	0.00	0.00	✓	QC21

Part Op 110 - Photocopy bluefile and create labels as per PPP D119-796-141 chg 004

Descriptions: 130 - Bend tube as per Dwg D119-796-141 using CNC bender program

145 - 1- CUT TUBE AT HEIGHT ON FAI SHEET 2- VERIFY HEIGHT: _____ BY QC15 LEVEL

INSPECTOR: _____ 3- DEBURR CUT SURFACE

150 - ***** ENSURE PROPER JIG POSITIONING ***** ENSURE PROPER JIG POSITIONING

***** 1-DRILL TUBE AS PER DWG USING DT _____ 2- DRILL RIVET HOLES USING DT8787 FWD 3- DEBURR AND C'SINK RIVET HOLES AS PER DWG 4- FLIP TUBE, REPEAT STEP 2 AND 3 5- SCRIBE PART# AND BATCH# USING VIBRATING STYLUS ON INSIDE OF CUFF AS PER DWG D119-796-141 6- INSPECT AND REMOVE ALL MARKS FROM TUBE WITHIN LIMITS ON DWG D119-796-141

160 - ***IMMEDIATELY AFTER GRINDING*** 1- handfinish X-TUBE INSIDE AND OUT 2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT AS PER QSI005.

180 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038Or Issue P/O: _____ LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order

190 - Ensure copy of NDT results attached to work order.

200 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D119-796-141

230 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____ ***VERIFY BY _____ PART # TO MATCH W/O _____ ***MASK SCRIBE B# & P# AND VERIFY*** 1- Prime Inside of tube. 2- Install nut plates as per dwg (D2873-043) 3- Mask cuffs per note#2. 4- Prime exterior of tube per QSI005. Primer

Batch: **138646** Start Time: _____ Finish Time: _____

240 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____

242 - Assemble as per dwg D119-796-141 and Qsi 015 1- Abrade mating surfaces with Scotch Brite 7447 and clean with Dupont 4105s or equivalent as per dwg. 2- Install D5152-041 with proseal 890 on concave surface, 0.100" MIN thick as per dwg using DT10089 (identified right and left) *****MAINTAIN CLAMPING PRESSURE ON FOR MIN 72HRS*****

Proseal Batch: **138708** EXP: **5/18** PROSEAL CURE TIME 72 HOURS:

Start: **17-12-19** Finish: **17-12-19** 3- Install support and shim using proseal 890 per dwg and clamp in position.

244 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____

246 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____ 1- Remove all non-fixed hardware and clean any excess proseal. 2- Scuff tube with Scotch Brite 7447. 3- Mask cuff per note#2. 4- Prime as per dwg and QSI005 5- Apply matte clear as per dwg and QSI005 Clear Batch: **Primer 138676**

248 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____ 1- Mask underside of tube as per dwg. Mask cuff per note#2. 2- Scuff tube with Scotch Brite 7447 3- Paint outside of crosstube Paint

Batch: **138637**

250 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____

252 - 1- Re-install non fixed hardware per dwg ***Torque all clamps to 80-100 IN-LBS.*** 2- Apply a filet-seal of proseal 890 around supports. Allow proseal to dry before inspecting. Proseal 890 Batch: _____

EXP: _____ PROSEAL CURE TIME 72 HOURS: Start: _____

Finish: _____

260 - ***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED AS PER DWG.*** ***VERIFY BY _____ BATCH # TO MATCH W/O _____

290 - Identify and pack for shipping as per PPP D119-796-141

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation F165311	D119-796-141TRN	1	0	0	0
242-Crosstubes	CR3212-4-08 M137963-13	16	0	0	0
	D2873-043 500319	4	0	0	0
	D5123-3 5006028	4	0	0	0
	D5124-1 8164912-147	2	0	0	0
	D5152-041 5000695	2	0	0	0
	D5305-1 5005899	2	0	0	0
252-Crosstubes	MS21920-24 M137820-160	4	0	0	0

Part Specifications

Specifications could not be found.

Plex 10/2/17 1:10 PM Dart.lajeunesse.marie

Work Order ID 165701***165701***

Page 1

Monday, August 28, 2017 12:51:36 PM

Item ID: D119-796-141

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference:

DAS

21
9-89Approvals: Process Plan: _____ Date: **AUG 30 2017**

Tooling: _____

Date: _____

Run

Start

NR1

QC: _____ Date: _____

SPC (Y/N): _____

Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D119-796-141

H

IIN-D119-796

F

110

Document Control

0.00

110

DC

Memo

0.02

Doc.Control -USB or Paperwork

Photocopy bluefile and create labels as per PPP D119-796-141 chg 004

120

Pick Kit

0.00

120

Packaging

Packaging

Memo

0.02

Packaging

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ No Re-verification ☐ Design ☐ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence							
		OTHER : ☐							

Work Order ID 165701***165701***

Page 2

Monday, August 28, 2017 12:51:36 PM

Item ID: D119-796-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 8/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 9/20/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 *130* CNC Bend 2 CNC Alpha 160 Bender	BENDING MACHINE - CROSSTUBES Memo Bend tube as per Dwg D119-796-141 using CNC bender program	1.63 0.94							
140 *140* QC Quality Control	QC15- Crosstube Dimensional Check Memo	0.00 0.02							
145 *145* Crosstubes Crosstubes	 Memo 1- CUT TUBE AT HEIGHT ON FAI SHEET 2- VERIFY HEIGHT: _____ BY QC15 LEVEL INSPECTOR: _____ 3- DEBURR CUT SURFACE	0.00 1.86							

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Monday, August 28, 2017 12:51:36 PM

Page 3

5- SCRIBE PART# AND BATCH# USING VIBRATING STYLUS ON INSIDE OF CUFF AS PER DWG D119-796-141

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER :						
Misidentified ☐	☐	Past Due ☐							

Monday, August 28, 2017 12:51:36 PM

165701

Item ID: D119-796-141

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: FWD Crosstube Installation without Step (no hardware)

Stop *NS2*

Start Date: 8/24/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 Req'd Qty: 1.00 * 1 *

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID**Tool #****Plan
Code**

**Accept
Qty**

Reject
QtyReject
Number

**Insp.
Stamp**

160

Crosstubes Chemical Conversion

0.00

160

HandFXtube

Memo

1.54

Hand Finishing Crosstubes

1- INSPECT AND REMOVE ALL MARKS FROM TUBE WITHIN LIMITS
ON DWG D119-796-141

IMMEDIATELY AFTER GRINDING

2- PRESSURE WASH X-TUBE INSIDE AND OUT

3- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT AS PER OSI005.

4- Verify grinding marks By:

175

QC7-Inspect Chemical Conversion Coat

0.00

175

QC

Memo

0.02

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 5

Item ID: D119-796-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 8/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 9/20/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 *180* Outsource2 Outsource process - NDT	Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038Or Issue P/O: _____ LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order	0.00 120.00							
190 *190* Packaging Packaging	Pick Kit Packaging Memo Ensure copy of NDT results attached to work order.	0.00 0.02							
200 *200* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D119-796-141	0.00 0.02							

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 6

Item ID: D119-796-141

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	Spray Painting per QSI005 4.2	0.00							
230	SprayPaint								
Spray Painting	Memo	1.36							
	***VERIFY BY _____ BATCH # TO MATCH W/O _____								
	***VERIFY BY _____ PART # TO MATCH W/O _____								
	MASK SCRIBE B# & P# AND VERIFY								
	1- Prime Inside of tube.								
	2- Install nut plates as per dwg (D2873-043)								
	3- Mask cuffs per note#2.								
	4- Prime exterior of tube per QSI005.								
	Primer Batch: _____								
	Start Time: _____								
	Finish Time: _____								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

165701

Monday, August 28, 2017 12:51:36 PM

Accept

N900040100

Setup Start *NS1*

Stop *NS2*

Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 **Req'd Qty:** 1.00 *** 1 ***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID**Tool #****Plan
Code**

**Accept
Qty**

Reject
QtyReject
Number

**Insp.
Stamp**

240

QC14- Inspect Spray Paint

0.00

240

QC

Memo

0.02

Quality Control

***VERIFY BY _____ BATCH # TO MATCH W/O

***VERIFY BY _____ PART # TO MATCH

W/O

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 8

Item ID: D119-796-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 8/24/2017 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 9/20/2017 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

242

0.00

242

Crosstubes

Crosstubes

Memo

1.08

Assemble as per dwg D119-796-141 and Qsi 015

1- Abrade mating surfaces with Scotch Brite 7447 and clean with Dupont 4105s or equivalent as per dwg.

2- Install D5152-041 with proseal 890 on concave surface, 0.100" MIN thick as per dwg using DT10089 (identified right and left)

****MAINTAIN CLAMPING PRESSURE ON FOR MIN 72HRS****

Proseal Batch: _____

EXP: _____

PROSEAL CURE TIME 72 HOURS:

Start: _____

Finish: _____

3- USE DT10304 PINS TO LOCATE SUPPORTS. Install support and shim using proseal 890 per dwg and clamp in position.

Proseal Batch: _____

EXP: _____

PROSEAL CURE TIME 72 HOURS:

Start: _____

Finish: _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Monday, August 28, 2017 12:51:36 PM

Page 9

Setup Start *NS1*

Stop *NS2*

Start Date: 8/24/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 Req'd Qty: 1.00 * 1 *

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/
Run Hours**Tool ID****Tool #**Plan
Code

**Accept
Qty**

Reject
QtyReject
Number

**Insp.
Stamp**

244

QC5- Inspect part completeness to step on W/O

0.00

244

QC

0.02

Quality Control

Memo

***VERIFY BY _____ BATCH # TO MATCH W/O

***VERIFY BY _____ PART # TO MATCH _____

W/O _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 10

Item ID: D119-796-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 8/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 9/20/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
246	Spray Painting per QSI005 4.2	0.00							

246

SprayPaint

Spray Painting

Memo

0.33

***VERIFY BY _____ BATCH # TO MATCH W/O

***VERIFY BY _____ PART # TO MATCH
W/O _____

MASK SCRIBE B# & P# AND VERIFY

1- Remove all non-fixed hardware and clean any excess proseal.

2- Scuff tube with Scotch Brite 7447.

3- Mask cuff per note#2.

4- Prime as per dwg and QSI005

Primer Batch: _____

Start Time: _____

Finish Time: _____

5- Apply matte clear as per dwg and QSI005

Clear Batch: _____

Start Time: _____

Finish Time: _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐						
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY								
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐			Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐			Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
		OTHER : ☐								

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 11

Item ID: D119-796-141**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** FWD Crosstube Installation without Step (no hardware)**Start Date:** 8/24/2017 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 9/20/2017 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

248

Spray Painting per QSI005 4.2

0.00

248

SprayPaint

Memo

0.00

Spray Painting

***VERIFY BY _____ BATCH # TO MATCH W/O

***VERIFY BY _____ PART # TO MATCH
W/O _____

MASK SCRIBE B# & P# AND VERIFY

1- Mask underside of tube as per dwg. Mask cuff per note#2.

2- Scuff tube with Scotch Brite 7447

3- Paint outside of crosstube

Paint Batch: _____

Start Time: _____

Finish Time: _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 12

Item ID: D119-796-141

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

250

QC14- Inspect Spray Paint
Crosstubes

0.00

250

0.00

QC

Memo

Quality Control

***VERIFY BY _____ BATCH # TO MATCH W/O

***VERIFY BY _____ PART # TO MATCH
W/O _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : 					

Monday, August 28, 2017 12:51:36 PM

Page 13

Proseal 890 Batch: _____
EXP: _____

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____			

Work Order ID 165701

Monday, August 28, 2017 12:51:36 PM

165701

Page 14

Item ID: D119-796-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: FWD Crosstube Installation without Step (no hardware)
Start Date: 8/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 9/20/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260 *260* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo ***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED AS PER DWG.*** ***VERIFY BY _____ BATCH # TO MATCH W/O _____ ***VERIFY BY _____ PART # TO MATCH W/O _____ ***MASK SCRIBE B# & P# AND VERIFY***	0.00 0.02				_____	_____	_____	_____
290 *290* Packaging Packaging	Identify as per dwg & Stock Location: _____ Packaging Memo Identify and pack for shipping as per PPP D119-796-141	0.00 0.00				_____	_____	_____	_____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Monday, August 28, 2017 12:51:36 PM

Page 15

Accept

Setup Start *NS1*

Stop *NS2*

Start Date: 8/24/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 9/20/2017 **Req'd Qty:** 1.00 *** 1 ***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/
Run Hours**Tool ID****Tool #****Plan
Code**

Accept	Qty
--------	-----

Reject
QtyReject
Number

**Insp.
Stamp**

300

QC21- Final Inspection - Work Order Release

0.00

300

QC

Memo

0.10

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

Picklist Print

Page 1

Monday, August 28, 2017 12:51:38 PM

Work Order ID: 165701

165701

Parent Item: D119-796-141

D119-796-141

Parent Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017

Required Date: 9/20/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 14.09.03 NEW ISSUE DD VRF:JLM IPP
REV:B 14.10.15 AS PER REV.B DD VRF:JLM IPP REV:C
14.11.19 AS PER REV.C DD VRF:JLM IPP REV:D 14.12.12
AS PER REV.pd1 DD VRF:JLM IPP REV:E 15.02.11 AS PER
REV F JLM VERIFIED BY:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D5305-1		Manufactured	No			242	Each	9.0000	2	2			
D5305-1									**				
Shim													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG056				9					
				155334				9					
D119-796-141TRN		Manufactured	No			120	Each	1.0000	1	1			
D119-796-141TRN									**				
Crosstube Turning Detail													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG014				1					
				161736				1					
D2873-043		Manufactured	No			230	Each	137.0000	4	4			
D2873-043									**				
Nut Plate Assembly													
				<u>Location</u>				<u>Loc Qty</u>		<u>Loc Code</u>			
				LG050				137					
				161520				9					
				161580				18					
				162854				40					
				163314				20					
				164360				50					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Monday, August 28, 2017 12:51:38 PM

Page 2

Work Order ID: 165701

165701

Parent Item: D119-796-141

D119-796-141

Parent Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017

Required Date: 9/20/2017

Start Qty: 1.00

Required Qty: 1.00

D5123-3 Manufactured No 242 Each 542.0000 4 4

D5123-3

Clamp Cushion

**

Location

Loc Qty

Loc Code

LG052

200

160079

200

LG054

342

153233

342

D5124-1 Manufactured No 242 Each 22.0000 2 2

D5124-1

Fwd Support

**

Location

Loc Qty

Loc Code

LG054

22

152391

1

155857

8

156435

5

162844

4

164338

4

D5152-041 Manufactured No 242 Each 24.0000 2 2

D5152-041

Fwd Post Mount Assembly

**

Location

Loc Qty

Loc Code

LG055

24

162000

10

163422

4

163423

6

164459

4

Monday, August 28, 2017 12:51:38 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : ☐					

Picklist Print

Monday, August 28, 2017 12:51:38 PM

Page 3

Work Order ID: 165701

165701

Parent Item: D119-796-141

D119-796-141

Parent Item Name: FWD Crosstube Installation without Step (no hardware)

Start Date: 8/24/2017

Required Date: 9/20/2017

Start Qty: 1.00

Required Qty: 1.00

CR3212-4-08

Purchased

No

230

Each

334.0000

16

16

CR3212-4-08

RIVET

Location

Loc Qty

Loc Code

CCK003

100

m138357

100

LG056

234

m136442

34

m137587

100

m137963

100

MS21920-24

Purchased

No

252

Each

100.0000

4

4

MS21920-24

Clamp

Location

Loc Qty

Loc Code

FG

2

117998

2

LG050

98

m136016

4

m136986

19

m137820

25

m137963

25

m138336

25

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐				
Misidentified ☐	Past Due ☐	OTHER :			

DART AEROSPACE LTD		Work Order:	165701
Description: Crosstube Fwd, with Step		Part Number:	D119-796-141
Inspection Dwg: D119-796-141 Rev: H		Page 1 of 1	

Required Dimension	Min	Max
Height	21.490	21.750
1/2 Span	39.820	40.080
Angle	54°	57°
Total Span	79.640	80.160
Bending Passes	8	--
Crushing	--	6.8%

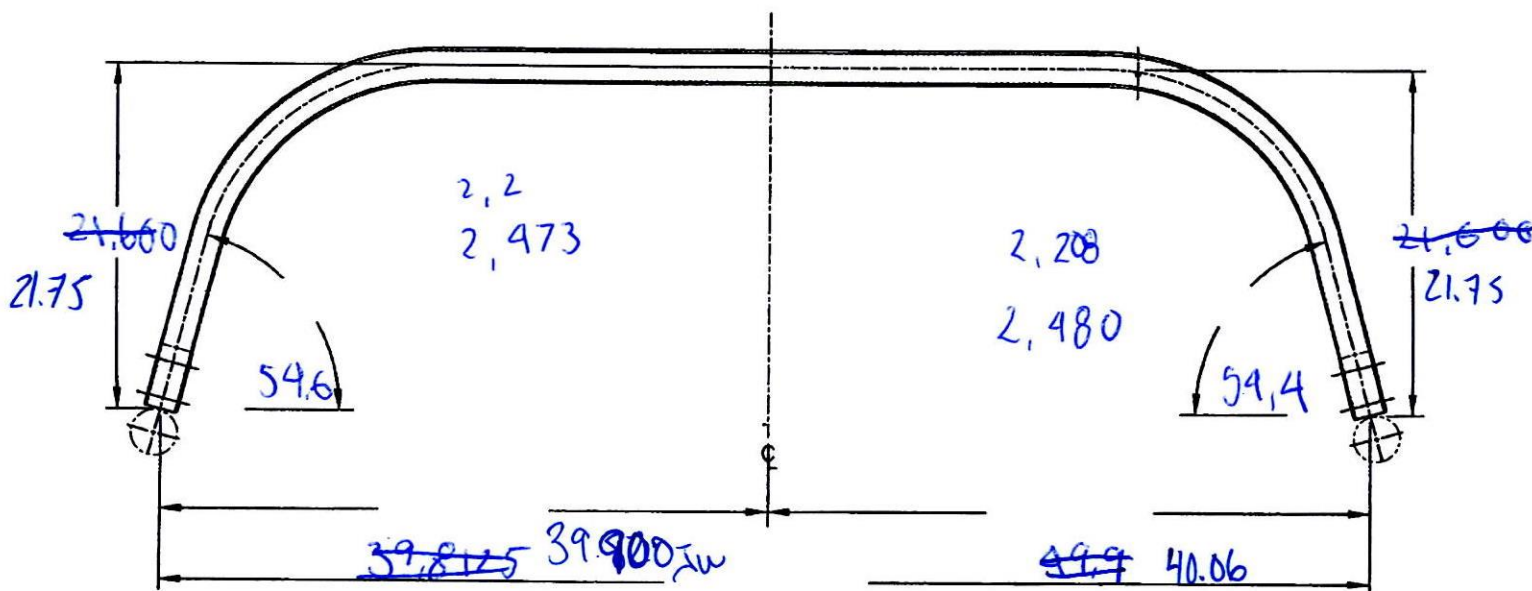


	Side A	Side B
Bending Passes	10	11
Crushing	5.8%	5.8%
Comments		
DAS		
47		

QC15 Inspection	9-89
Date	17-11-17

Rev	Date	Change	Revised by	Approved
A	15.04.14	New Issue	KJ	
B	15.11.12	Dwg Rev updated	KJ	
C	16.01.15	Dwg Rev updated	KJ	47

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-141	XTUBE ASSY (AW119 MKII FWD)
1	1	D119-796-141BND	CROSSTUBE, FWD
2	4	D2873-043	RADIUS BLOCK
3	4	D5123-3	CLAMP CUSHION
4	2	D5124-1	FWD SUPPORT
5	2	D5152-041	FWD POST MOUNT ASSY
6	2	D5305-1	SHIM
7	16	CR3212-4-08	RIVET, BLIND CSK
8	4	MS21920-24	CLAMP

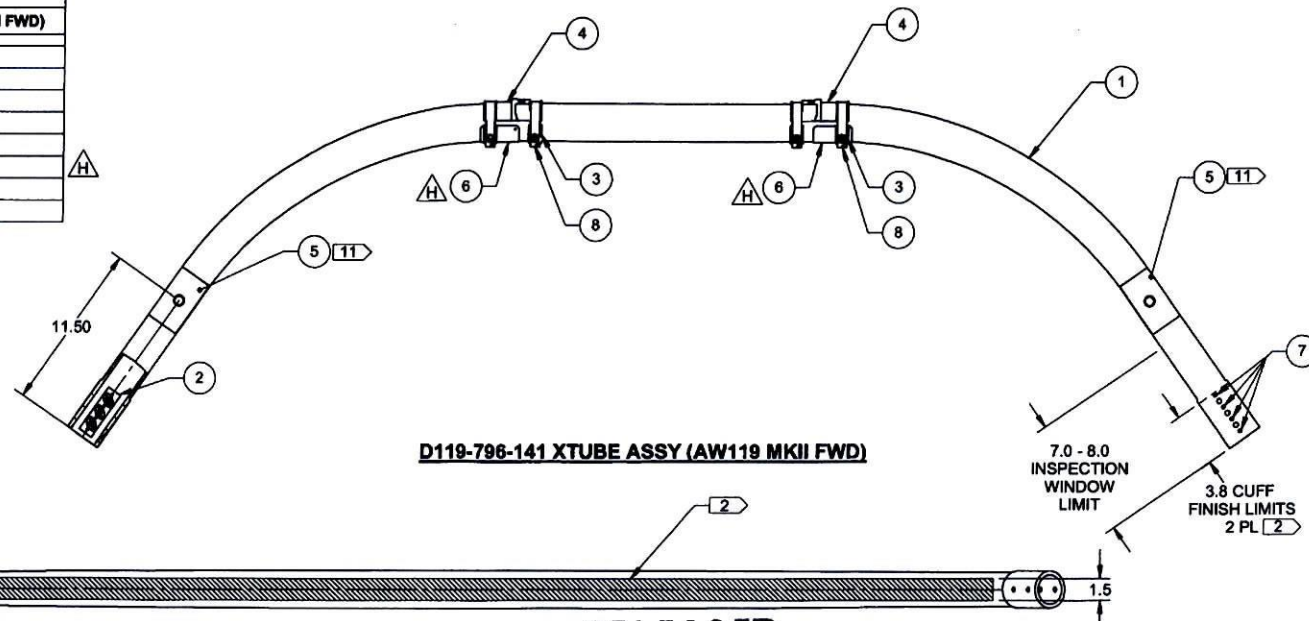

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 165701 413 170870

RELEASED
2015-11-04
EAW 15-642

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY MATTE CLEAR COAT PER QSI 005 4.2
MASK D5124-1 FWD SUPPORTS, D5305-1 SHIMS AS WELL AS UNDERSIDE OF CROSSTUBE AS SHOWN (B3-1, HATCHED AREA),
PAINT OUTSIDE PER DART QSI 005 4.2 AFTER APPLYING CLEAR COAT
DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-141" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 18.54 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE.
THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS.
DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) PRIOR TO FINISHING, ABRASE MATING SURFACES OF D5124-1 FWD SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'NWIPE DEGREASER. APPLY A 0.1 MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5124-1 FWD SUPPORTS AND INSTALL AT AN 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL THE MS21920-24 CLAMPS AND D5123-3 CLAMP CUSHIONS WHILE WET.
- 10) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY, THE NUT IS FACING AFT AND HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-041 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'NWIPE DEGREASER. INSTALL D5152-041 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.1 MIN THK. LOCATE D5152-041 USING TOOL DT10089.
- 12) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5305-1 SHIM WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'NWIPE DEGREASER. INSTALL D5305-1 SHIM WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.1 MIN THK. USE ADDITIONAL TEMPORARY MS21920-24 CLAMP TO APPLY CLAMPING PRESSURE FOR 72 HOURS.

H	ADD D5305-1 SHIM, D6024-103 WAS D6005-103, D5124-1 NOW INSTALLED ON PRIMER	AP	15.10.13
G	FINISHING ORDER ADJUSTED, CR3212-4-08 WAS -07, CUFF DIA TOLERANCE INCREASED TO +/- 0.005	AP	15.04.24
F	REMOVED PRIME/ PAINT ON CUFFS, 2.516 WAS 2.500 (C8-5)	AP	15.02.03
E	D5152-041 FWD STEP POST ASSY WAS D5150-1 STEP POST, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER, ANGLE (B7-2) DIMENSIONED FROM NEW DATUM	DB	15.01.15
D	ADD D5150-1 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHEET 1, MODIFIED NOTES ON SHT 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WERE CR3212-4-09, 7.5 DEG CUFF ANGLE OFFSET REMOVED (SHT 3), CUFF DIAMETER ON D119-796-141TRN REDUCED TO 2.500, ADDED INSPECTION WINDOW (B7-3), ADDED SHT 4	AP	14.10.23
B	ADDED D2873-043 RADIUS BLOCK, CR3212-4-09 RIVETS, ADDED SKIDTUBE REFERENCE FOR LOCATING CUFF HOLES, RE-ORGANIZED NOTES AND REMOVED REDUNDANT INFORMATION	AP	14.09.02
A	NEW ISSUE	AP	14.08.09
REV.	DESCRIPTION	BY	DATE
DESIGN	AP		
DRAWN	AP		
CHECKED	AJS		
MFG. APPR.	JLM		
APPROVED	WM		
DE APPR.	DS		
DATE	15.10.13		


DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO.
D119-796-141


TITLE
XTUBE ASSY (AW119 MKII FWD)

REV. H
SHEET 1 OF 8
SCALE
NTS


COPYRIGHT © 2014 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

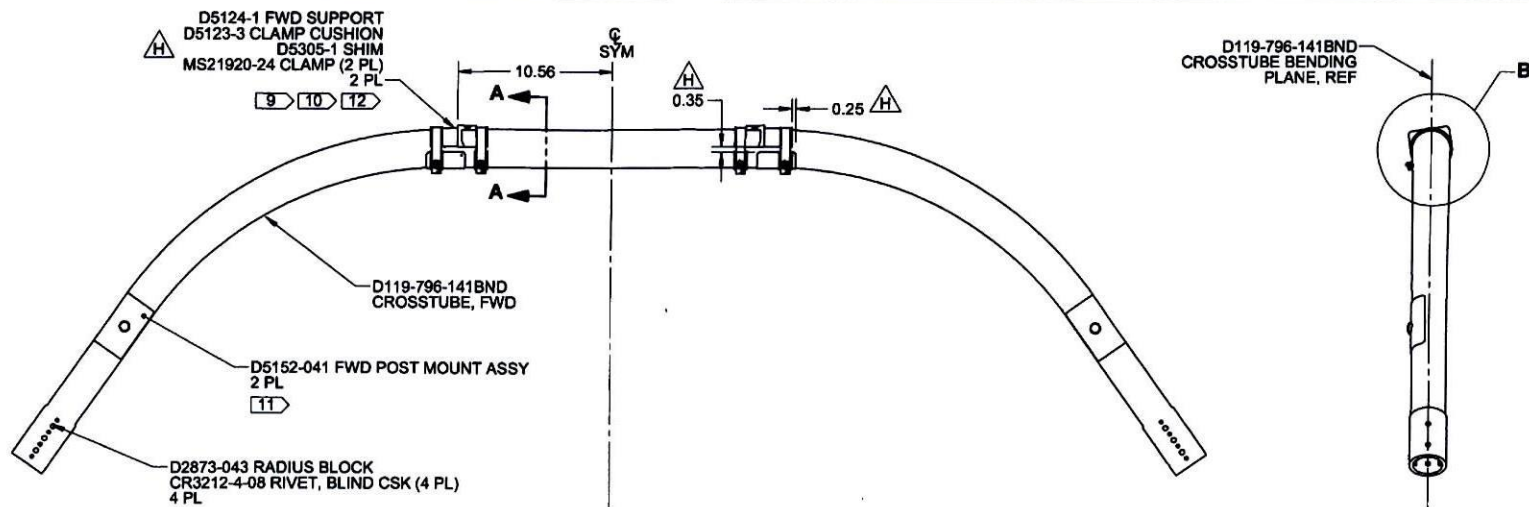

D119-796-141 XTUBE ASSY (AW119 MKII FWD)

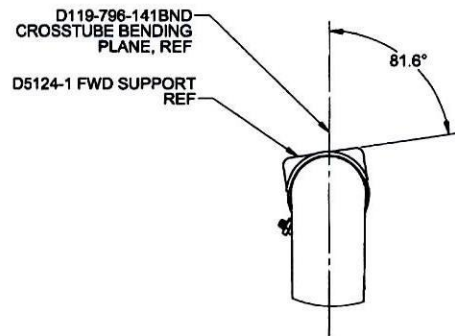

DETAIL B
SCALE 2X

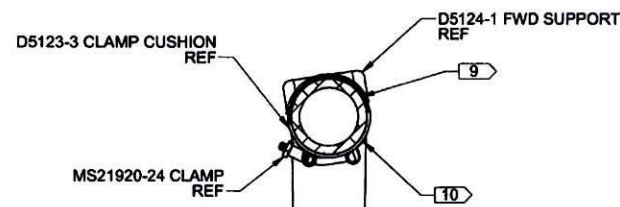



SECTION A-A
SCALE 2X

RELEASED
2015-11-04


APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. H
MFG. APPR.	JLM	D119-796-141	SHEET 2 OF 8
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

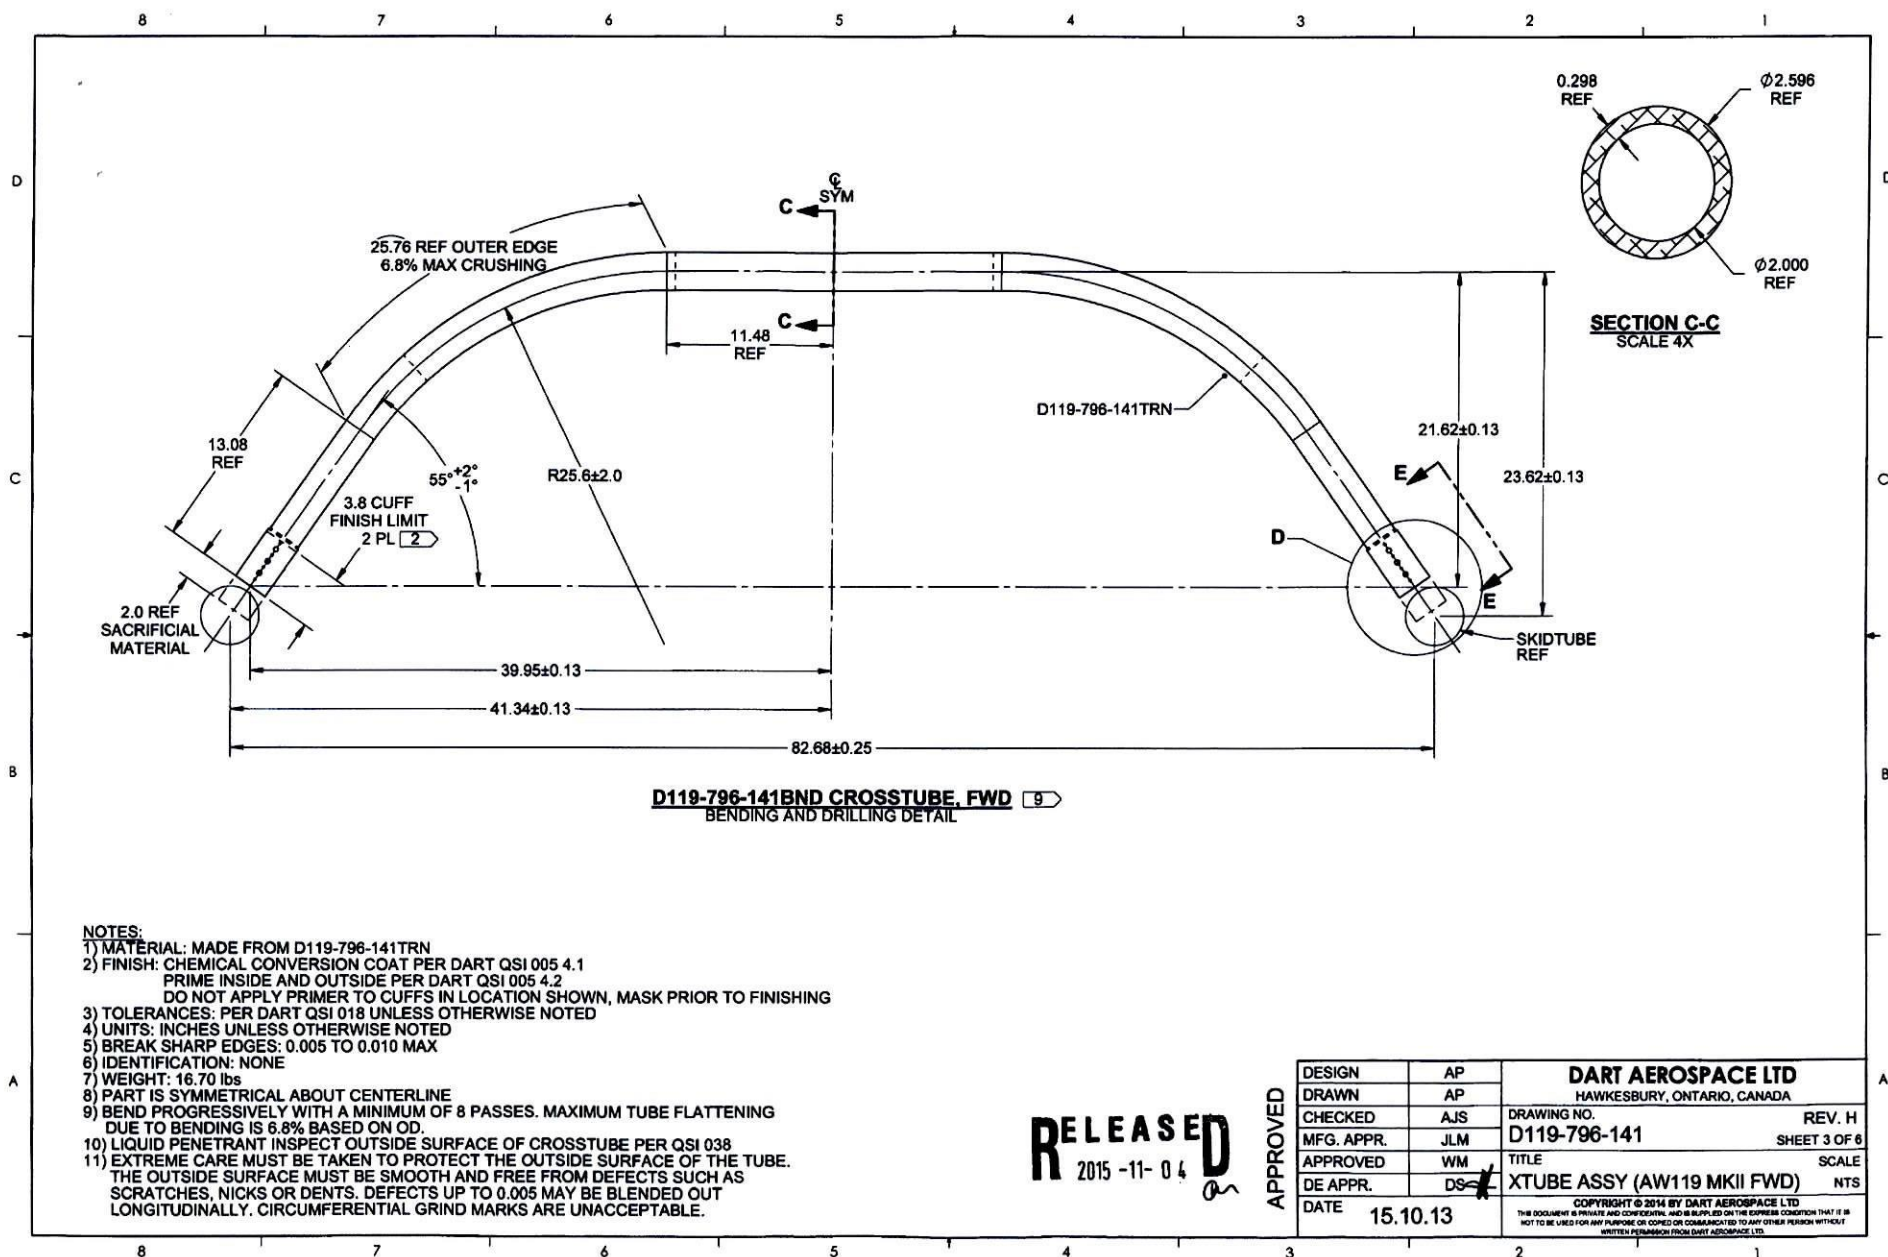

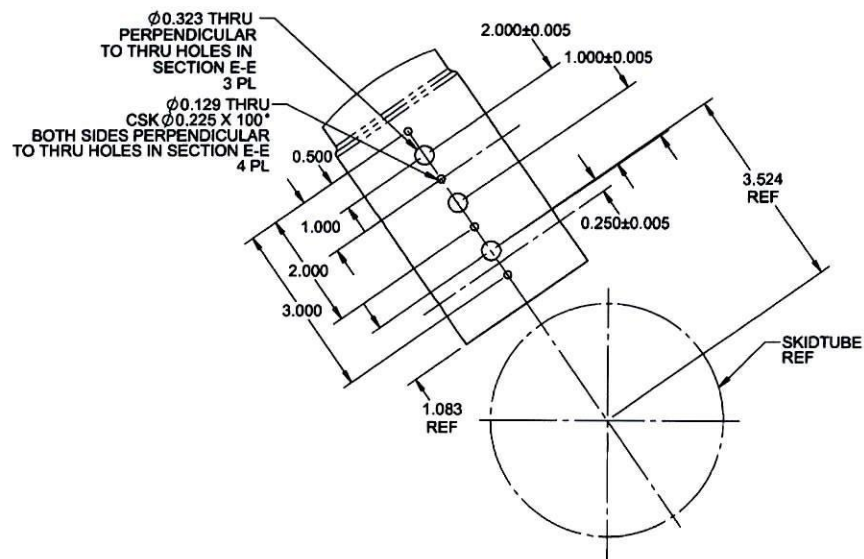

VIEW D
SCALE 4X


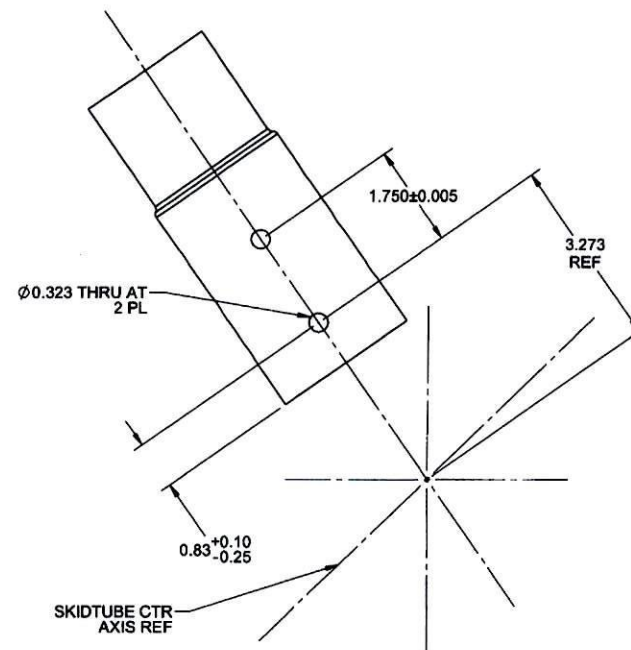


VIEW E-E
SCALE 2X

RELEASED
2015-11-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. H
MFG. APPR.	JLM	D119-796-141	SHEET 4 OF 6
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

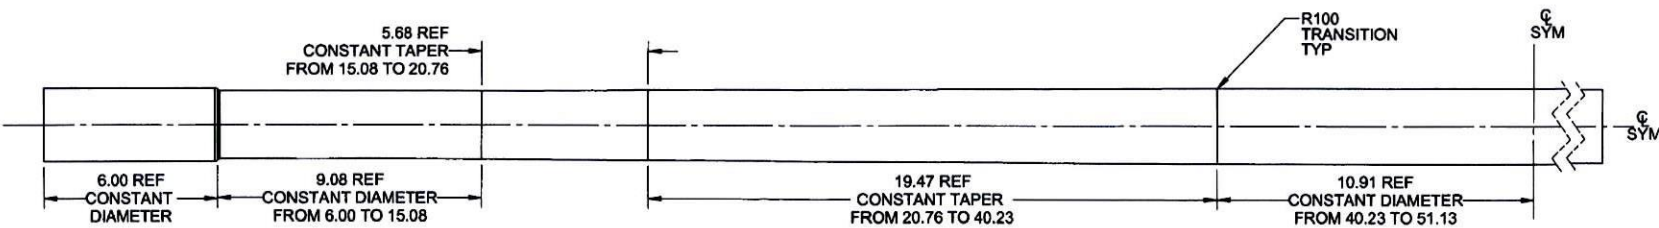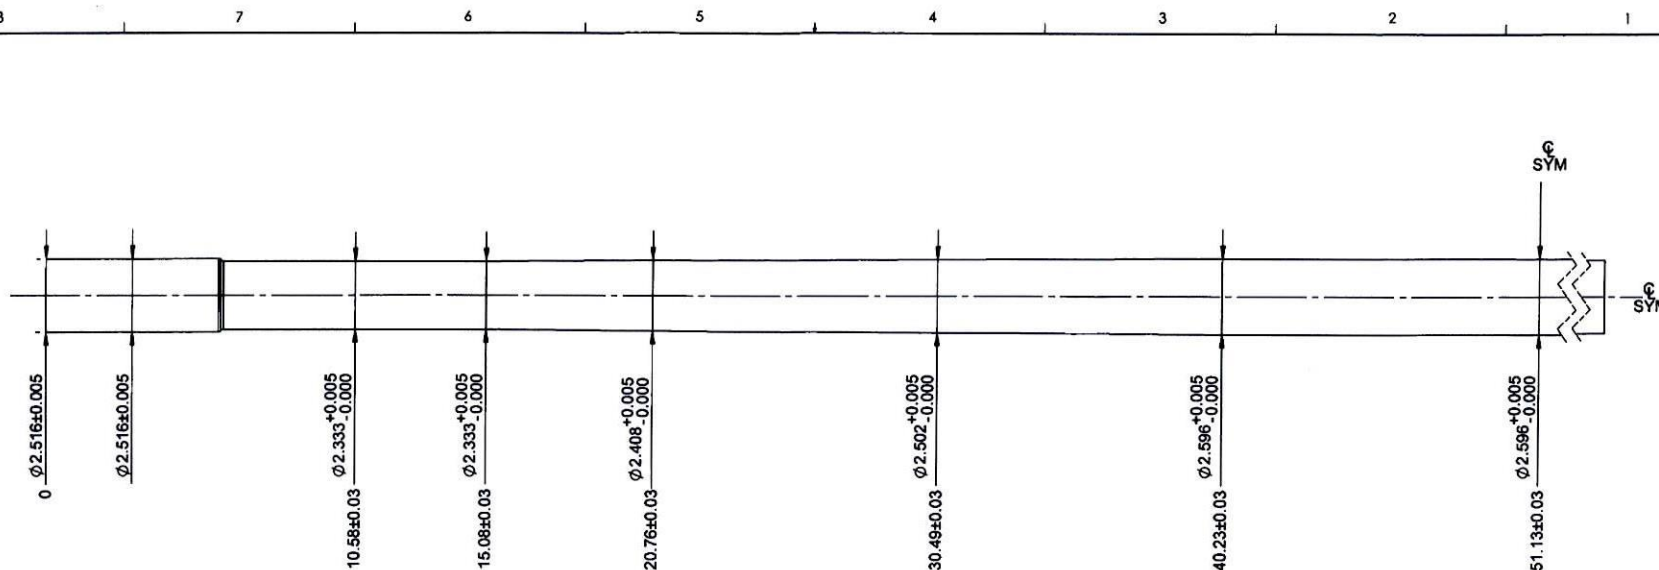

D119-796-141TRN CROSSTUBE, FWD

- NOTES:**
- 1) MATERIAL: MANUFACTURE FROM D6024-103 (PREFERRED) OR D6005-103
FINISHED LENGTH = 102.26 ±0.020 (BEFORE BENDING/TRIMMING)
 - 2) FINISH: NONE
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: NONE
 - 7) WEIGHT: 16.70 lbs
 - 8) PART IS SYMMETRICAL ABOUT CENTERLINE

RELEASED
2015-11-04
APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. H
MFG. APPR.	JLM	D119-796-141	SHEET 5 OF 6
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

CHAMFER ID
AS REQUIRED
FOR TOOLING

F

C
SYM

C
SYM

0.258 REF
NOMINAL WALL

0.167 REF
NOMINAL WALL

0.167 REF
NOMINAL WALL


0.204 REF
NOMINAL WALL

0.251 REF
NOMINAL WALL

0.298 REF
NOMINAL WALL

0.298 REF
NOMINAL WALL

D119-796-141TRN CROSSTUBE, FWD
SUPPLEMENTAL VIEW: NOMINAL WALL THICKNESS

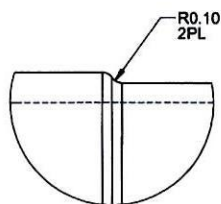

DETAIL F
SCALE 2X

RELEASED
2015-11-04

APPROVED
an

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. H
MFG. APPR.	JLM	D119-796-141	SHEET 6 OF 6
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

**skyservice****Work Order Traveler**
Sky Service F.B.O. Inc.

PO 038410

10105 Ryan Avenue, Dorval, Quebec, H9P 1A2

TCCA AMO 53-89 / EASA 145.714 / BDA AMO 385

WO #: MWO34098	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO038410
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 19 CROSSTUBES AS PER PO038410

6 AFT CROSSTUBES , P/N# D119-796-241 , J/S# 164137, 168120, 168119, 165573, 164136, 168330,

5 FWD CROSSTUBES, P/N# D119-796-141 , J/S# 165701, 168121, 165702, 164478 164479

4 FWD CROSSTUBES , P/N# D206-667-107BL , J/S# 168325-C, 168325-D, 168325-E, 168325

4 AFT CROSSTUBES, P/N# D206-667-207BL , J/S# 168327, 168327-A, 168327-B, 168327-G

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417-M13 NO CRACK FOUND PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923 , EMU. MPO15896, DEV. MPO11715 , UV LIGHT M-20142						NOV 20 2017	
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:	ACA/SCA Stamp 	Date: NOV 20 2017
Name: RAFIK MELIKIAN		